

SPECIFICATION & SETTING ***for Jewellery 310/610***

Features:

- 1. Max weighing capacity 300 gms for model 310 and 600 gms for model 610.**
- 2. Accuracy of 0.01 gm or say 10 mg.**
- 3. Front back high bright led display.**
- 4. Front on/off feature.**
- 5. Piece counting.**
- 6. Can weight in Carat /Tola /Gram.**
- 7. Optional computer interface.**
- 8. Battery back up of 10 hours with inbuilt battery.**

Front key function:

There are five keys as follows

- 1. On/off : This key is for switch on/off the machine.**
- 2. Z/T : This key is the tare key, Pressing this key will tare the weight which is on the pan.**
- 3. N/G : This key is for Net/Gross weight check.**
- 4. UP : This key is for internal setting of the machine.**
- 5. Func : This is the mode key and pressing this key you can switch to carat, tola and gram**

CALIBRATION:-The calibration is very simple. First wait for 0000 in weighing mode and wait for stability dot to be cleared. Then put 1/3 weight of full capacity on spans and ignore the display. Now press key up and func. Simultaneously and we saw PASSWORD on display. Now press Z/T and display shows 20000. Now enter weight if it is different than 200 gms. We can change the weight by N/G key & Up key. Up for increase and N/G key for shift display and press Z/T key. Now wait for 30 second and machine goes to linearity calibration mode. Here switch off and again switch on the machine and calibration is completed. But if display shows **err** after password then check in count mode that the counts are changing properly or not.

COUNTING: - Make sure the machine is in weighing mode. Now keep some pieces on span and press key 4. The display shows counts. Then press Z/T and display changed to P.00000. Now enter the no. Of pieces which are kept on the pan with the help of N/G & UP key as in Calibration and then press Z/T. Now machine is in piece counting mode. Now press again Func. and machine will be in weight mode.

(FOR THIS FUNCTION YOU HAVE TO CONTACT YOUR DEALER TO ACTIVATE)